

# Manhole Inspection Summary

## Manhole # S21EE1019MH

Printed On: 12/17/2008

Page 1 of 5

**Inspection** ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **21EE1** Node: **019** Status: **Found**

Insp Date: **2/22/07 1:18 PM**

Incomplete Comments

Crew: **CH, JJ**  
Inspector: **Hale, C**  
Firm: **RKK**

**Location** Address: **I-83**

Cross Street: **41ST ST**

**Manhole** Type: **Junction** Location: **Easement / Right of Way**

Ground Conditions: **Wet**

☒ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments **Bolted Lid - missing bolts. There is heavy clear flow from the I4 pipe. The I5 pipe picture shows active infiltration.**

**Cover** Shape: **Circular** Diameter: **30** (in.) Length: (in.) Dist A/B Grade: **3** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☒ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **2** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment** ☒ Exists Material: **Unknown** ☐ Parged Height: **24** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Corbel** Material: **Unknown** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Barrel** Material: **Unknown** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Bench** ☐ Exists Material: ☐ Parged ☐ Debris (not Condition related)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Unknown** ☐ Parged ☐ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps** Count: **11** Missing: **0** ☒ **Corroded**

**Surcharge** ☒ **Evidence Of Surcharge** Depth: **2** (ft.) ☐ Active Surcharge Present

Location View



Top View



Corroded steps.

Defect



Adjustment, Corbel and Barrel infiltration - other side.

Defect



Adjustment and Barrel infiltration.


## Manhole Inspection Summary

Manhole # S21EE1019MH

Printed On: 12/17/2008

Page 3 of 5

### 60 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock

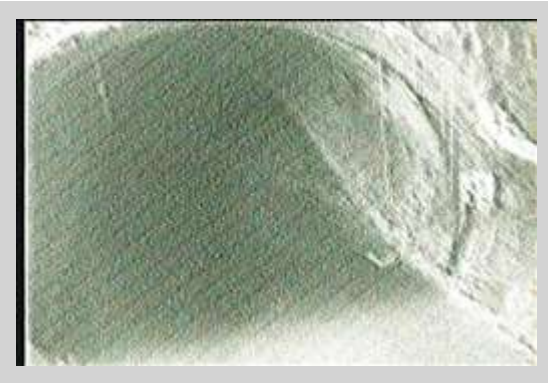

Rod and Bar (Angled)

Pipe Material: **Concrete** ☐ Pipe Lined

Invert Depth: **18.85** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Roots**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

### 8 in. Circular Gravity Sewer Pipe In @ 4 O'Clock



Evidence of surcharge.

Rod and Bar (Angled)

Pipe Material: **Unknown** ☐ Pipe Lined

Invert Depth: **16.25** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Dead End**

☐ Possible Illicit Connection

## Manhole Inspection Summary

Manhole # S21EE1019MH

Printed On: 12/17/2008

Page 4 of 5

### 8 in. Circular Gravity Sewer

Pipe In @ 5 O'Clock



Active infiltration.

Rod and Bar (Angled)

Pipe Material: **Unknown** ☐ Pipe Lined

Invert Depth: **11.29** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Dead End**

☐ Possible Illicit Connection

### 60 in. Circular Gravity Sewer

Pipe In @ 6 O'Clock



Rod and Bar (Angled)

Pipe Material: **Concrete** ☐ Pipe Lined

Invert Depth: **18.75** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

## Manhole Inspection Summary

Manhole # S21EE1019MH

Printed On: 12/17/2008

Page 5 of 5

8 in. Circular Gravity Sewer

Pipe In @ 11 O'Clock



Rod and Bar (Angled)

Pipe Material: **DIP/CI**

☐ Pipe Lined

Invert Depth: **11.65** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence**

Pipe Seal Cond: **Roots**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection